

M8x30 - 4ks
M10x30 - 2ks
M12x70 - 2ks
(M12x17 - 4ks)



M8 - 4ks
M10 - 2ks zvar.
M12 - 2ks (0ks)






P8 - 8ks
P10 - 2ks



PP8 - 4ks
PP10 - 2ks
PP12 - 2ks (4ks)

C

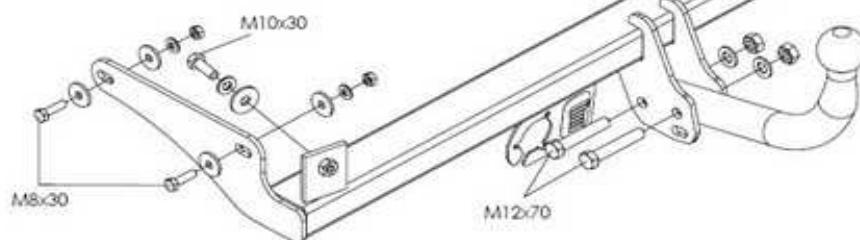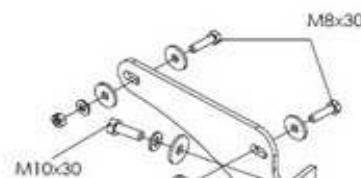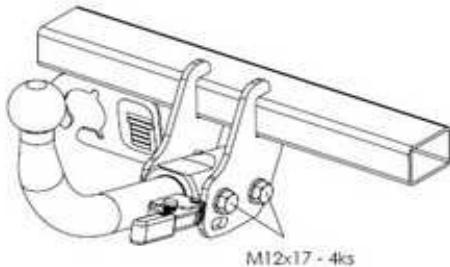

A

RENAULT THALIA - R083A/C - 07062007

NÁVOD NA MONTÁŽ:

R0835

- Skontrolujte kotevné miesta pre uchytenie ťažného zariadenia – odstráňte nadbytočné množstvo ochranej nástrekovej hmoty.
- Ťažné zariadenie vložte medzi nosníky, následne ho prichyťte upevňovacími skrutkami podľa obrázka. Tie dotiahnite momentom podľa tabuľky.
- Skontrolujte dotiahnutie skrutiek spojovacej gule (držiaka spojovacej gule) momentom podľa tabuľky.
- Upevnite zásuvku na držiak. Pretiahnite zväzok vodičov z vonkajšej strany dovnútra vozidla cez gumovú prechodku, umiestnenú v ľavej časti zadného čela karosérie. Vodiče zapojte podľa návodu.
- Skontrolujte správnosť pripojenia elektroinštalácie.

FITTING INSTRUCTIONS:

- Check anchoring points to attach the tow-bar to - remove any excessive protective coating.
- Place the tow-bar between the bars and then attach the tow-bar using fixation screws as shown in the picture. Tighten them as shown in the table.
- Make sure the screws of the linkage ball (holder of the linkage ball) are tightened to the torque shown in the table.
- Fix the holder socket. Pull a conductor bunch from outside to the inside of the vehicle through a rubber reducer located at the left part of the rear plate of the body. Connect the conductors as described in the instructions for use.
- Make sure the electrical installation is properly connected.

DÔLEŽITÉ UPOZORNENIA:

- V miestach stykových plôch sa musí odstrániť pružná ochrana karosérie vozidla.
- Vŕtané otvory treba ošetriť antikoróznou hmotou.
- Použite len dodaný spojovací materiál v predpísanej triede kvality.
- Elektrické zariadenie sa namontuje podľa podmienok prevádzky cestných vozidiel na pozemných komunikáciách.
- Údaj S o maximálnom zvislom zaťažení na guľu je uvedený na výrobnom štítku ťažného zariadenia.
- Na ťažnom zariadení nie je možné nič upravovať ani meniť.
- Pred ukončením montáže je nutné prekontrolovať všetky spoje podľa tabuľky uťahovacích momentov!
- V prípade akýchkoľvek nejasností je nutné obrátiť sa na výrobcu ťažného zariadenia.
- Výrobca nenesie zodpovednosť za škody spôsobené nesprávnym použitím výrobku.

IMPORTANT ATTENTIONS:

- Remove insulating material on a car body in grips and joints of a coupling device with a car body.
- Put the anticorrosive substance on the drilled holes.
- Use supplied mechanical strength jointing material.
- Wiring of a coupling device must be up to a standard and car maker requirements.
- Statement S about the maximum vertical ball downtime is printed on the tow bar label.
- On the tow bar is no modification possible.
- Check all the joints, look in the table of the spinning moments, before finishing the montage!
- Contact the tow bar marker with any questions.
- The manufacturer is not responsible for the damages caused by wrong using on the product.

Tabuľka uťahovacích momentov skrutkových spojov pevnosti 8.8 / Table of specified torque and hardenss settings 8.8

M6 - 9,5Nm, **M8** - 23Nm, **M10** - 46Nm, **M10x1,25** - 49Nm, **M12** - 79Nm, **M12x1,25** - 87Nm, **M12x1,5** - 83Nm, **M14** - 125Nm, **M16** - 195Nm